



Mottagare: Kontrollanter, kontrollantelever, klubbar, MC Norden, HL	Datum: 2007-02-15	Bilag: Service Bulletin	Blad nr: 1 av 1
Ärende: Materielvarning nr. 1/07			
Fastställt av MK: 2007-02-15	Ersätter:	Utfärdare: SFF Materielkommitté (MK)	

### **Bakgrund**

Skador funna på reservhandtagets ändstopp under krympslangen som täcker det pressade stoppet innan handtaget.

### **Omfattning**

Alla tandem reservhandtag tillverkade av Relative Workshop före Oktober 2004.

### **Åtgärd**

Samtliga reservhandtag tillverkade av Relative Workshop före Oktober 2004 skall kontrolleras enligt service bulletin PBS#301007.

Efter kontroll ersätts svart krympslang med genomskinlig krympslang.

### **När**

Före nästa hopp

### **Bilaga**

Product Service bulletin PBS #300107 daterad januari 30, 2007

UNINSURED **UNITED PARACHUTE TECHNOLOGIES, LLC.**

---



---

***PRODUCT SERVICE BULLETIN***

***PBS #300107***

***TANDEM LOOP STYLE RESERVE  
RIPCORDS***

***JANUARY 30, 2007***

**Quality Assurance Department**

1645 LEXINGTON AVENUE ♦ DELAND FL 32724-2106 ♦ TELEPHONE +1 386 736 7589 ♦ FAX +1 386 734 7537  
WWW.UPTVECTOR.COM



**Product Service Bulletin**

**January 30, 2007  
PBS #301007**

**Subject: Tandem Loop Style Reserve Ripcords**

**Status: Mandatory inspection before next jump**

**Identification: All tandem loop style reserve ripcords manufactured by Relative Workshop prior to October 2004. Identified by black shrink wrap on the swage.**

**Background: Ripcord damage found in field on January 18, 2007. Rig was an older Vector II.**

**Service Bulletin:**

**Uninsured United Parachute Technologies, LLC requires that all tandem loop style reserve ripcords with black shrink wrap on the swage are inspected (instructions attached) for any broken filaments. If found, ripcord needs to be replaced immediately. If ripcord has no broken filaments, place 1/4" clear shrink wrap on swage. Since October 2004, clear shrink wrap is used to visibly inspect the filaments.**

**Materials Required: 1/4" clear shrink wrap**

**Tools Required: N/A**

**Qualified Personnel: Any certified rigger may perform this inspection.**

**Compliance Date: Before next jump**

**Authority: uninsured United Parachute Technologies, LLC**

**Distribution: uninsured United Parachute Technologies website, Parachutist & Skydiving Magazine, Drop Zone.com, PIA and FAA.**

**QUALITY ASSURANCE DEPARTMENT**

**1645 LEXINGTON AVENUE ♦ DELAND FL 32724-2106 ♦ TELEPHONE +1 386 736 7589 ♦ FAX +1 386 734 7537  
WWW.UPTVECTOR.COM**

**BROKEN RIPCORD CABLE**



Example of broken ripcord cable.


**SWAGE COVERED  
WITH HEAT  
SHRINK**



Normal ripcord cable.

To check for wear on the cable, remove heat shrink from the swage.

**UNCOVERED  
SWAGE**

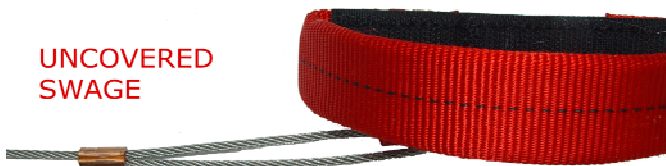

After removing the heat shrink, check for broken filaments. If any are found, replace the ripcord immediately.